

3GPP TSG RAN Meeting #26
Vouliagmeni Athens, Greece, 8 - 10 December, 2004

RP-040470

3GPP TSG-RAN WG3 Meeting #45
Yokohama, Japan, 15th – 19th November 2004

R3-041655

Title: LS on the TSG RAN WG 3 Review of TR 32.804 v6.0.0
Release: Rel-6
Work Item: **Remote Control of Electrical Tilting Antennas**

Source: RAN3
To: TSG SA WG 5
Cc: TSG RAN, TSG SA

Contact Person:
Name: **Andreas Hauser, Vodafone Group**
Tel. Number: **+49-172-2161910**
E-mail Address: Andreas.Hauser@vodafone.com

Attachments: R3-031452: Summary of the RAN3 review of TR 32.804 on O&M requirements for RET

1. Overall Description:

At the last SA plenary #25 the Technical Report TR 32.804 on RET Requirements was approved and placed under change control as version 6.0.0 (Rel-6). During the discussion the TSG RAN chairman asked to send the TR to TSG RAN WG3 for review in order to make sure that the TR is aligned with the RAN specifications for the lunt interface in series 25.46x.

Therefore, TSG RAN WG 3 reviewed the TR and would like to provide the outcome of the review to TSG SA WG 5 in the attached document R3-041452 which was agreed as the TSG RAN WG 3 opinion at RAN3#45.

In addition TSG RAN WG3 has noted that Annex B in the TR contains information that is not related to current RAN3 WI for RET and also appears to be unrelated to RET. Support for a broader scope including e.g. TMAs has not been discussed nor been part of this WI as future requirements in TSG RAN WG 3 for this WI.

2. Actions:

To SA5 group:

ACTION:

- TSG RAN WG 3 kindly asks TSG SA WG 5 to take the feedback on TR 32.804 v6.0.0 provided by TSG RAN WG 3 into account when updating the TR.

3. Date of Next TSG RAN WG 3 Meetings:

TSG RAN WG 3 Meeting #46 14 – 18 February 2005, Scottsdale, Arizona, USA
TSG RAN WG 3 Meeting #47 9 – 13 May 2005, tbd, Europe

3GPP TR 32.804 V6.0.0 (2004-09)

Technical Report

**3rd Generation Partnership Project;
Technical Specification Group Services and System Aspects;
Telecommunications management;
Remote control of Electrical Tilting (RET) antennas;
Requirements
(Release 6)**



The present document has been developed within the 3rd Generation Partnership Project (3GPPTM) and may be further elaborated for the purposes of 3GPP.

The present document has not been subject to any approval process by the 3GPP Organizational Partners and shall not be implemented. This Specification is provided for future development work within 3GPP only. The Organizational Partners accept no liability for any use of this Specification. Specifications and reports for implementation of the 3GPPTM system should be obtained via the 3GPP Organizational Partners' Publications Offices.

Keywords

UMTS, antenna

3GPP

Postal address

3GPP support office address

650 Route des Lucioles - Sophia Antipolis
Valbonne - FRANCE
Tel.: +33 4 92 94 42 00 Fax: +33 4 93 65 47 16

Internet

<http://www.3gpp.org>

Copyright Notification

No part may be reproduced except as authorized by written permission.
The copyright and the foregoing restriction extend to reproduction in all media.

© 2004, 3GPP Organizational Partners (ARIB, ATIS, CCSA, ETSI, TTA, TTC).
All rights reserved.

Contents

Foreword.....	4
Introduction.....	4
1 Scope	5
2 References	6
3.1 Definitions	6
3.3 Abbreviations	6
4 Requirements for RET control over Itf-N	7
4.1 Fault Management	7
4.2 Configuration.....	7
4.3 Static Configuration Management (CM)	7
4.4 Maintenance	8
4.5 IRPManager feedback	8
5 Issues	8
Annex A: Return (error) codes defined in TR 25.802	9
Annex B: Future requirements	10
Annex C: Change history.....	11

Foreword

This Technical Report has been produced by the 3rd Generation Partnership Project (3GPP).

The contents of the present document are subject to continuing work within the TSG and may change following formal TSG approval. Should the TSG modify the contents of the present document, it will be re-released by the TSG with an identifying change of release date and an increase in version number as follows:

Version x.y.z

where:

- x the first digit:
 - 1 presented to TSG for information;
 - 2 presented to TSG for approval;
 - 3 or greater indicates TSG approved document under change control.
- y the second digit is incremented for all changes of substance, i.e. technical enhancements, corrections, updates, etc.
- z the third digit is incremented when editorial only changes have been incorporated in the document.

Introduction

There has been an initiative to standardize an interface to control Remote Electrical Tilting (RET) antennas. This is an enabler to remotely manage multi-vendor control of RET antennas from a centralised Operations Support System (OSS) via the Itf-N.

1 Scope

The present document defines the requirements for the network wide control of RET antennas via the Itf-N. Two example types of RET antennas are those that are tilted using a mechanical tilting mechanism and those that use a phased array.

The control of RET antennas has been studied in 3GPP [TSG RAN WG3](#) with an approved work item for “Remote Control of Electrical Tilting Antennas” provided in RP-030193 at RAN#19 in March 2003, producing [a TR 25.802 \[1\] and a series of specifications for the new Iuant interface TS 25.460 \[8\], TS 25.461 \[9\], TS 25.462 \[10\], and TS 25.463 \[8,9,10,11\]](#) approved at RAN#25 in June 2004.

The ability to control Antenna tilt permits cell size to be adjusted, thereby permitting control of up and downlink throughput.

The ability to control Antenna tilts remotely from a network management system permits a network wide perspective to be obtained and for settings to be adjusted in response to predicted population movements, or in response to performance monitoring data to help make the best use of the available radio access network.

Figure 1 shows the main Network Elements (NEs) and depicts the two system contexts A and B where the IRP Agent may be located either in the Element Manager (EM), or within the Network Element (NE).

The RET antenna control capability may be achieved either by using one of the two layer 1 options (RS485 [cable option](#) and [coax-feeder-cable-Modem option](#) which permits RET controls to be sent to the tower top equipment via the coaxial feeder) [specified in \[9\]](#).

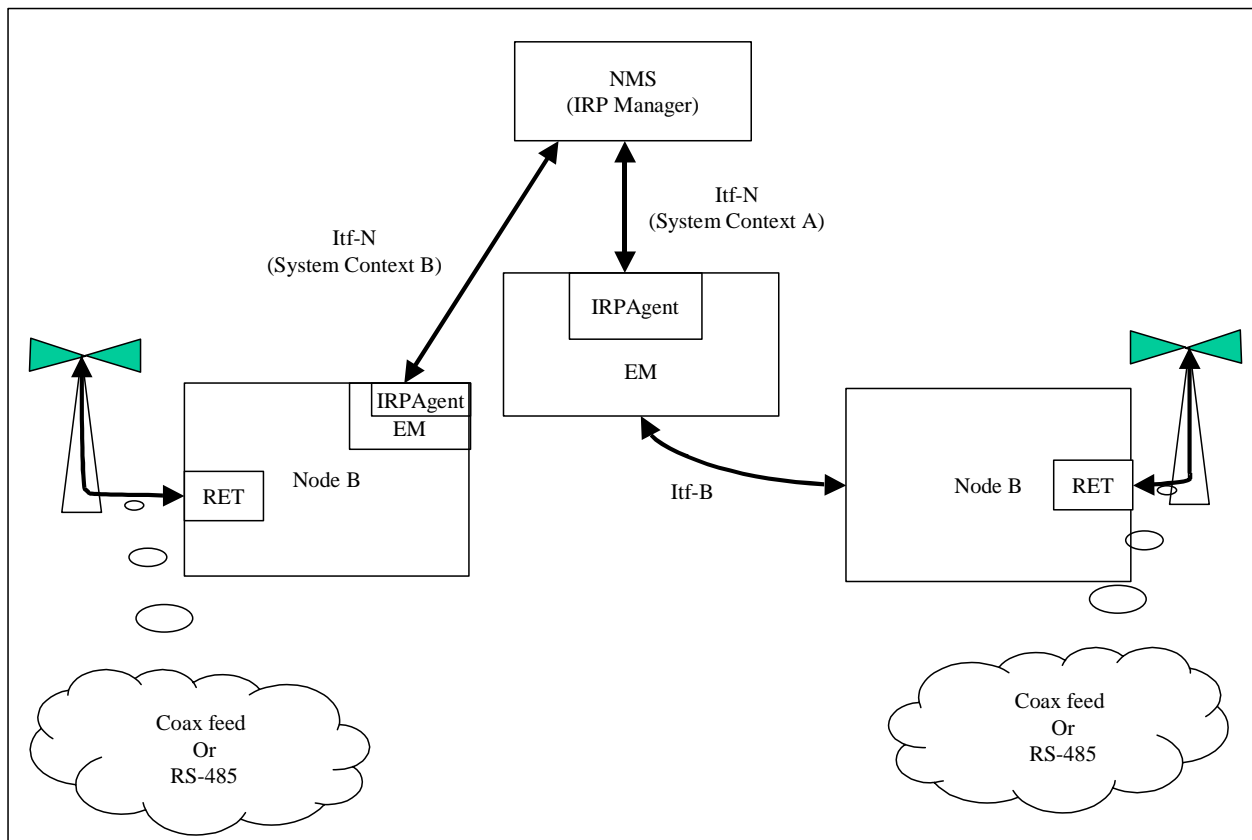


Figure 1

2 References

The following documents contain provisions which, through reference in this text, constitute provisions of the present document.

- References are either specific (identified by date of publication, edition number, version number, etc.) or non-specific.
- For a specific reference, subsequent revisions do not apply.
- For a non-specific reference, the latest version applies. In the case of a reference to a 3GPP document (including a GSM document), a non-specific reference implicitly refers to the latest version of that document *in the same Release as the present document*.

- [1] 3GPP TR 25.802: "Remote control of electrical~~ly~~ tilting antennas".
- [2] 3GPP TS32.401: "Telecommunication management; Performance Management (PM); Concept and requirements".
- [3] 3GPP TS 32.403: "Telecommunication management; Performance Management (PM); Performance measurements".
- [4] 3GPP TS32.411: "Telecommunication management; Performance Management (PM) Integration Reference Point (IRP): Requirements".
- [5] 3GPP TS32.412: "Telecommunication management; Performance Management (PM) Integration Reference Point (IRP): Information Service (IS)".
- [6] 3GPP TS 32.413: "Telecommunication management; Performance Management (PM) Integration Reference Point (IRP): Common Object Request Broker Architecture (CORBA) Solution Set (SS)".
- [7] 3GPP TS 32.102: "Telecommunication management; Architecture".
- [8] [3GPP TS 25.460: "UTRAN Iuant Interface: General Aspects and Principles"](#).
- [9] [3GPP TS 25.461: "UTRAN Iuant Interface: Layer 1"](#).
- [10] [3GPP TS 25.462: "UTRAN Iuant Interface: Signalling Transport"](#).
- [11] [3GPP TS 25.463: "UTRAN Iuant Interface: Remote Electrical Tilting \(RET\) Antennas Application Part \(RETAP\) Signalling"](#).

3.1 Definitions

For the purposes of the present document, the following terms and definitions apply:

IRPAgent: See [7].

IRPManager: See [7].

3.3 Abbreviations

For the purposes of the present document, the following abbreviations apply:

AISG	Antenna Interface Standards Group (http://www.aisg.org.uk/)
Itf-N	Interface N between a network or service management OSF and NE OSFs (TS 32.102 [7])
LNA	Low Noise Amplifier
OSF	Operations System Functions
OSS	Operations Support System
RDN	???

RET	Remote Electrical Tilting
RNS	Radio Network Sub-system
TMA	Tower Mounted Amplifier
TT	Tower Top
<u>UTC</u>	???

4 Requirements for RET control over Itf-N

4.1 Fault Management

- 1) Any fault detected by the RET equipment shall be passed up to the IRPManager.

4.2 Configuration

- 1) The IRPManager shall perform parameters range checking to avoid sending invalid parameters to a RET antenna.
- 2) It shall be possible to define a tilt angle for a single antenna.
- 3) It shall be possible to define the tilt angles for a large number of antennas.
- 4) There is no support for controlled session management i.e. the last configuration command received by the RET equipment will be effective (i.e. last command wins).
- 5) There shall be a capability to 'turn off' Itf-N commands and responses to/from a particular RET antenna to support local maintenance work which may require additional exceptions / notifications.

Editor's Note: This requirement should be more general, relating to all commands and responses on the Itf-N. If a general mechanism exists then this should also be used to block RET commands on the Itf-N. FFS, whether this is a requirement of Itf-N or not.

- 6) The results of configuration changes shall be provided to IRPManager(s).
- 7) The IRPManager may determine if a command is in progress for example device status==locked where a local field engineer has overridden the network manager's configuration capability to the local antenna.
Editor's Note: Two somewhat different issues. FFS.
- 8) The failure to configure a parameter shall be returned to the IRPManager making the configuration change. The reason for not configuring a parameter shall also be made available.
- 9) Where an operator finds it necessary the Itf-N will permit the definition of a sets of related values which are applied as near as possible at the same time (this may be of the order of a minute), e.g. a set of Antenna Tilt values for different cells which due to interactions need to be applied closely together. This is necessary so as to coordinate RET settings across the network with other related cell settings such as uplink and downlink parameters, gain settings, and coding allocations.

4.3 Static Configuration Management (CM)

- 1) A unique identifier (this may be an RDN combining cell, antenna and other identifiers) is used by the IRPManager to retrieve and configure parameters for a particular antenna. This unique identifier shall be used over the Itf-N interface.
- 2) It shall be possible for the IRPManager to learn of each unique antenna at a remote site via the Itf-N interface.
- 3) The IRPManager shall be able to determine whether an antenna can be remotely tilted or is instead fixed.
- 4) The IRPManager shall be able to determine the compass direction an antenna is facing.
- 5) The IRPManager shall be able to determine the angle of tilt for all antennas at a Node B, with a corresponding UTC time stamp of when the value was obtained.

- 6) The IRPManager shall be able to obtain the valid range of parameters each RET enabled antenna is able to support.
- 7) It shall be possible for the IRPManager to define and retrieve a descriptive label to be associated with any antenna.
- 8) For antennas which are not RET enabled, the IRPManager shall be able to obtain manually entered configuration data.
- 9) The IRPManager shall be able to retrieve diversity information. i.e. which antennas are involved in transmitting the same signal and which antennas are involved in receiving the same signal at the same site.
- 10) The IRPManager shall be able to retrieve the mechanical tilt offset for each antenna. (For RET enabled antennas the mechanical tilt offset provides the baseline from which RET adjustments are made.)
- 11) The IRPManager shall be able [to](#) retrieve the latitude, longitude and height of each antenna.

4.4 Maintenance

- 1) The IRPManager shall be able to cause the tilting mechanism to be exercised such that the complete range of tilt is exercised. At the end of the exercise the tilt will be set to a defined value.
- 2) It shall be permitted that settings may be provided by localised maintenance staff using a local craft terminal. Indications of local work shall be provided to remote operation support systems.
- 3) All locally applied settings will be sent to an IRPManager. There will not be any concurrency /_resource protection or complex resource locks being used, in terms of any conflicts between local settings and IRPManager settings, the last valid configuration parameter received will persist.
- 4) It shall be possible at the time of a RET installation for the maintenance staff to configure a compass direction which indicates the direction the antenna faces. ~~An IRPManager shall be able to obtain this compass direction setting.~~
- 5) It shall be possible to log the RET changes.

4.5 IRPManager feedback

- 1) The 3GPP interface for configuring RET will not include performance monitoring data. Where data is required to determine the performance of the network, existing PM techniques and parameters are to be used. Please refer to [2], [3], [4], [5] and [6].
- 2) If any form of bulk configuration is used, the IRPManager shall be notified if one or more parameters cannot be applied. The IRPManager may initiate the undoing of all successfully applied settings of a set using the bulk configuration. I.e. the set of system parameters and values are returned to the set of values that existed before the bulk configuration command was started.

5 Issues

Iff-N requirements need to be clearly marked as such in clauses 4.2 and 4.5.

Annex A: Return (error) codes defined in TR 25.802

TR 25.802 [1] subclause 6.1.6 defines a number of return (error) codes.

The table is copied below for convenience. The table in TR 25.802 provides the normative reference.

The following require possible mapping to probable causes in the notification IRP

Table A.1:

Code	Meaning	
0x00	OK	Normal response
0x01	Actuator Detection Fail	Signals from the actuator are detected but are abnormal, for example due to failed calibration.
0x02	Actuator Jam Permanent	Actuator cannot be moved
0x03	Actuator Jam Temporary	Actuator jam has been detected. No movement was detected in response to the normal stimulus.
0x04	Block Number Sequence Error	Used in combination with software download; block number sequence is wrong.
0x05	Busy	The device is busy and cannot respond until an activity is complete.
0x06	Checksum Error	Used in combination with software download; checksum incorrect.
0x07	Command Sequence Error	Used in combination with software download; command sequence is not permitted, eg a SetTilt command is received during software update sequence.
0x08	Data Error	RET AP data fault, e.g. length of data is inconsistent with length fields.
0x09	Device Disabled	Device is in logical Disabled state and cannot execute Set commands.
0x0A	EEPROM Error	EEPROM error detected
0x0B	Fail	Abnormal response. Indicates that a command has not been executed.
0x0C	Flash Erase Error	Used in combination with software download. indicates error when erasing flash memory.
0x0D	Flash Error	Used in combination with software download. indicates error when writing to flash memory.
0x0E	Not Calibrated	The device has not completed a calibration operation, or calibration has been lost.
0x0F	Not Scaled	No setup table has been stored in the device.
0x11	Other Hardware Error	Any hardware error which cannot be classified.
0x12	Other Software Error	Any software error which cannot be classified.
0x13	Out of Range	Value specified by a Set Tilt command is not supported by the device.
0x14	Position Lost	RET controller is unable to return a correct position value, for example there was a power failure while a SetTilt command was being executed.
0x15	RAM Error	An error was detected in reading data to/from RAM
0x16	Segment Number Sequence Error	Used in combination with software download; block sequence number is wrong.
0x17	UART Error	Hardware specific. This error may be sent after recovery from a temporary error which has prevented the sending or receiving of data.
0x19	Unknown Command	Received command is not defined in the version of AISG1 transmitted in the frame header, or the device has received a vendor-specific command with a vendor ID different from its own.

Annex B: Future requirements

This annex is a place holder for requirements which are not within the scope of RET for 3GPP Release 6.

These are provided since considerations for them may ease the future evolution of RET control.

- a) It shall be possible to adjust the gain of Low-Noise Tower Top Amplifiers.
- b) It shall be possible to relate ~~the~~ both ~~t~~ tilt angle and amplifier gain settings in a way which allows them to be applied as collections of values, which are configured at (as near as possible) the same time.
- c) It shall be possible to determine the current gain and gain settings of Tower Top (TT) Low Noise Amplifiers (LNAs).
- d) It shall be possible to define a number of pre-defined antenna profiles which may be activated at particular times of day (using UTC).

This requirement is FFS. Whether this applies to manager or agent is FFS.

- e) The interface will permit several configuration profiles per day to be supported; e.g. it is considered that 4 profiles would be sufficient but absolute number is likely to vary on a case by case basis.

This requirement is FFS.

- 6) It shall be possible to log the RET changes made using a local craft terminal.
- 7) Address the impact of failures. Use back up management systems-?
- 8) Consideration to delegating control to Node B software:
 - aiding network resilience.
 - reducing Itf-N signalling.

Annex C: Change history

Change history							
Date	TSG #	TSG Doc.	CR	Rev	Subject/Comment	Old	New
Jun 2004	S_24	SP-040264	--	--	Submitted to TSG SA#24 for Information	1.0.0	
Sep 2004	S_25	SP-040603	--	--	Submitted to TSG SA#25 for Approval	2.0.0	6.0.0

Title: Summary of the TSG RAN WG3 review of TR 32.804
v6.0.0 on O&M requirements for RET

Agenda Item: 11.3.2.1

Source: Vodafone Group (Rapporteur)

Document for: Information

1. Introduction

During the last SA plenary #25 the Technical Report TR 32.804 on RET Requirements was approved and placed under change control as versino 6.0.0 (Rel-6). During the discussion the TSG RAN chairman asked to send the TR to TSG RAN WG3 for review in order to make sure that the TR is aligned with the RAN specifications for the Iuant interface in series 25.46x.

Therefore, TSG RAN WG 3 was asked to review the TR and report any issues to TSG SA WG 5.

As this review did not happen during the last RAN3 meeting #44, the TR was provided at the RAN3 reflector on the 13th of October 2004 by MCC asking the TSG RAN WG 3 delegates to review the TR and make comments on the RAN3 reflector until RAN3 meeting #45.

This document provides a summary of the comments made by the TSG RAN WG3 delegates.

2. Summary of review comments made on the RAN3 reflector

Comments made by Siemens and Vodafone are given in the attached document and are marked with revision marks.

Except for some editorial changes the following comments/proposals were made:

- Introduction of the new specifications for the Iuant interface in the Scope and Reference section
- Comment on requirement 8) in sub-clause 4.3 whether the requirement is really needed as the scope of the TR in on RET devices
- Removal of the last part of requirement 4) in sub-clause 4.4 as this requirement is already captured in requirement 4) in sub-clause 4.3
- Proposal for Annex A to be removed at all if not really needed, or to be updated according to the information given in TS 25.463 instead of using Annex A of TR 25.802

3. Conclusion and Proposal

A summary of the review comments on TR 32.804 made on the RAN3 reflector until the 10th of November 2004 is given in this document.

RAN WG 3 is kindly asked to discuss the review comments and agree on them as the outcome of the TSG RAN WG3 review of TR 32.804 v6.0.0.

It is proposed to send a liaison statement to SA, RAN and SA5 in order to inform them about the outcome of the TSG RAN WG3 review of TR 32.804.